
KOP F

230V MAX. 1 x 7W GU10

Assembly instructions

WARNING: Assembly lamp with the power off.
1. Loosen the screws on both sides of the canopy. Attach the metal mounting arm to the surface on which the fixture is to be installed.
2. Connect the power cables to the connection block, tighten clamp screws, close the connection block.
3. Slide the canopy onto the mounting arm so that the holes on the arm and the canopy are aligned. Tighten the screws.
4. Install the light source in the bulb holder.

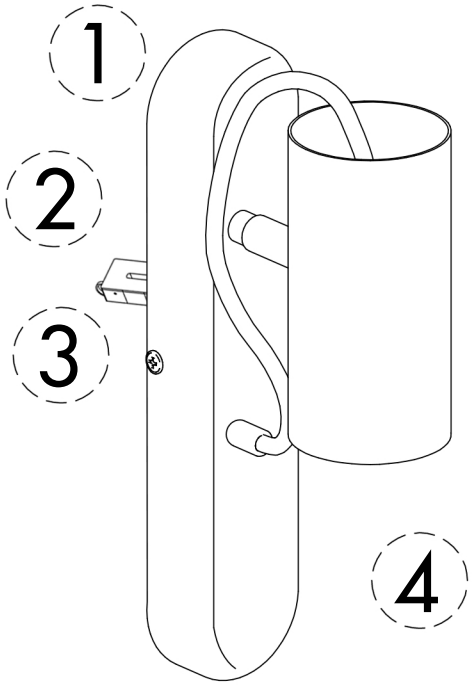

Used or broken electrical equipment must not be thrown into the trash bin together with other waste. Used device should be taken to a point of separate collection of municipal waste or a point of utilization of electrical equipment. Proper waste segregation is a very important aspect of environmental protection and must be strictly observed.

WARNING: The instalation should be performed by a qualified electrician.

Nowodworcowa 15, 81-581 Gdynia, tel. +48 736_812_848, info@ummo.pl

UMMO LIGHTING